

Washington Office Location

21850 88th Place South

Kent, WA 98031

Office: (253) 872-2000

Fax: (253) 872-7033

Email: info@nwindustrialrepair.com




Additional Locations

Eastern Washington: (509) 949-3368

Idaho & Montana: (208) 360-3833

Oregon: (503) 708-9609

RECONDITIONING A SUTORBILT GAGLBPA 7LP BLOWER

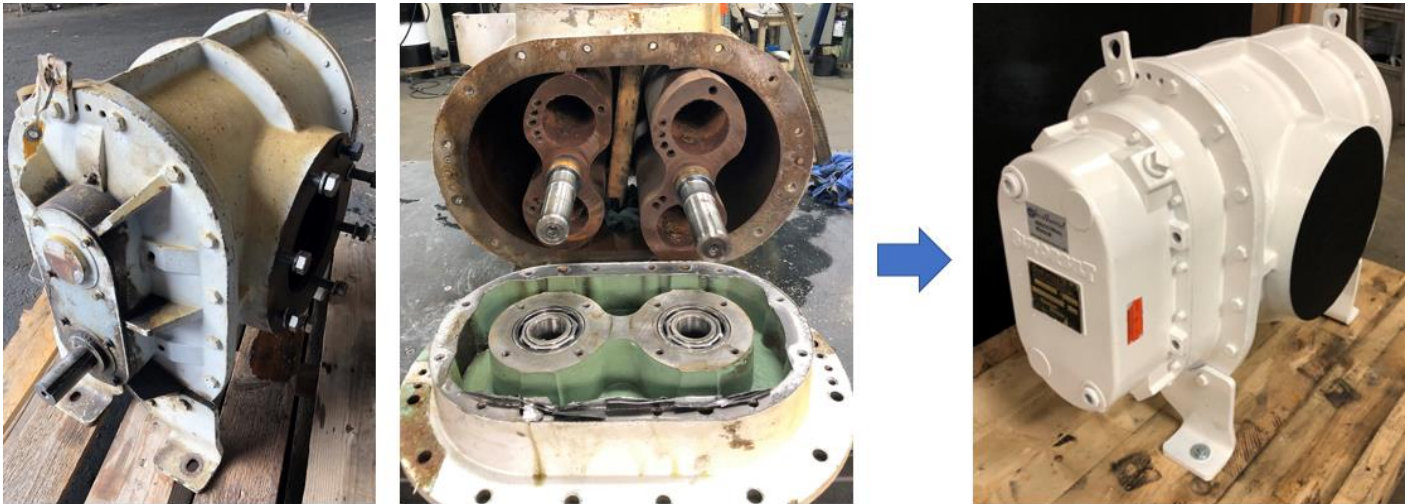

BEFORE

AFTER

- Base repair quote supplied to customer prior to receiving the equipment
- Complete visual inspection and disassembly of blower and components
 - Unit locked up
 - Gear assembly worn
 - Lip seal areas worn
- Pictures of tear down taken and included in firm quote with detailed description of required repairs
- Firm quote submitted to customer for approval prior to continuance of work
- Complete mechanical and chemical cleaning of all internal components and external surfaces
 - Ceramic coat seal journals
 - Bore and sleeve drive end bearing bore
 - Installation of new seals, bearings, gaskets and O-rings
 - Replace gear assembly
 - Replace oil sight glasses
- Set internal clearances to factory specs
- 60-minute test run of complete assembly
- Prep, paint and palletize for shipment